MiniSKiiP® 2 PIM	Output Inverter Application	1200V / 25A

General conditions

3phase SPWM		
V_{GEon}	=	15 V
V_{GEoff}	=	-15 V
R_{gon}	=	32 Ω
R_{goff}	=	32 Ω

Figure 1 IGBT

Typical average static loss as a function of output current

$P_{loss} = f(I_{out})$

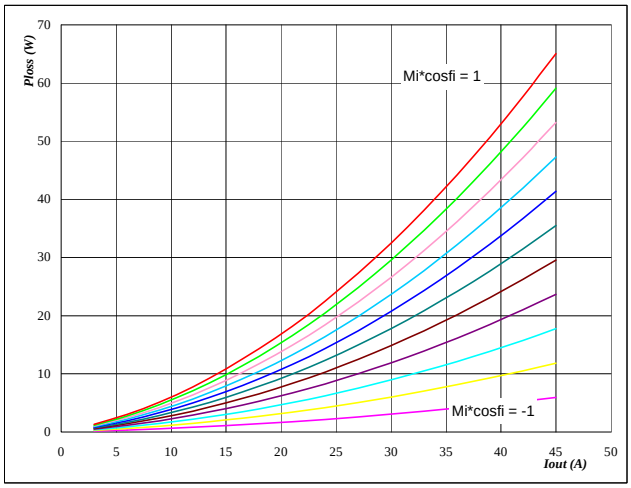

At

T_j = 150 ℃

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 2 FRED

Typical average static loss as a function of output current

$P_{loss} = f(I_{out})$

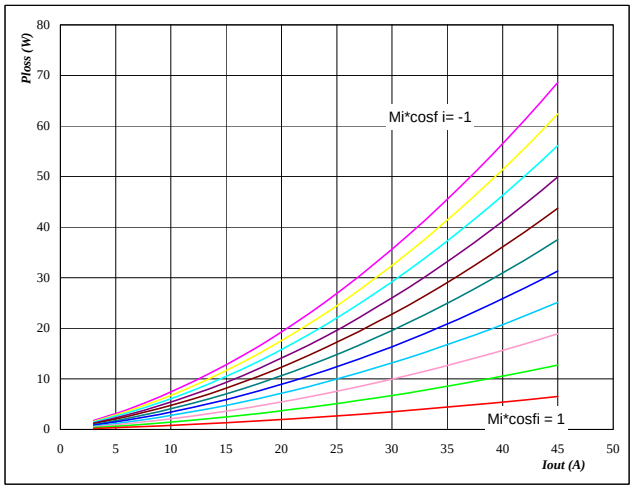

At

T_j = 150 ℃

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 3 IGBT

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

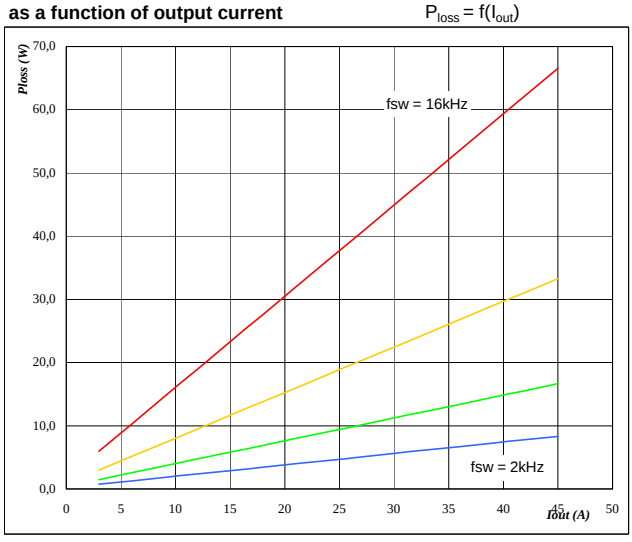

At

T_j = 150 ℃

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

Figure 4 FRED

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

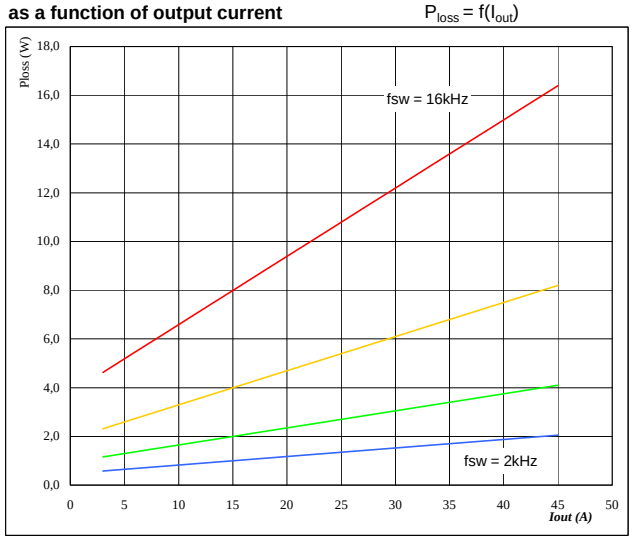

At

T_j = 150 ℃

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

MiniSKiiP® 2 PIM | **Output Inverter Application** | **1200V / 25A**

Figure 5 Phase

Typical available 50Hz output current as a function Mi*cosφ $I_{out} = f(Mi*\cos\varphi)$

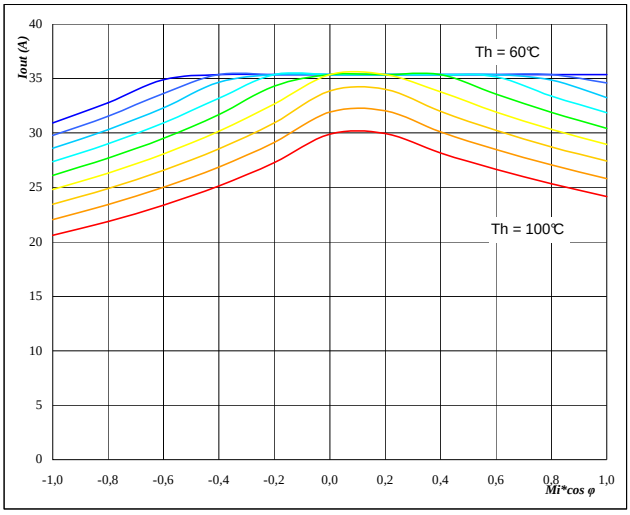

At

T_j =	150	℃
DC link =	600	V
f_{sw} =	4	kHz
T_h from	60 ℃ to 100 ℃ in steps of 5 ℃	

Figure 6 Phase

Typical available 50Hz output current as a function of switching frequency $I_{out} = f(f_{sw})$

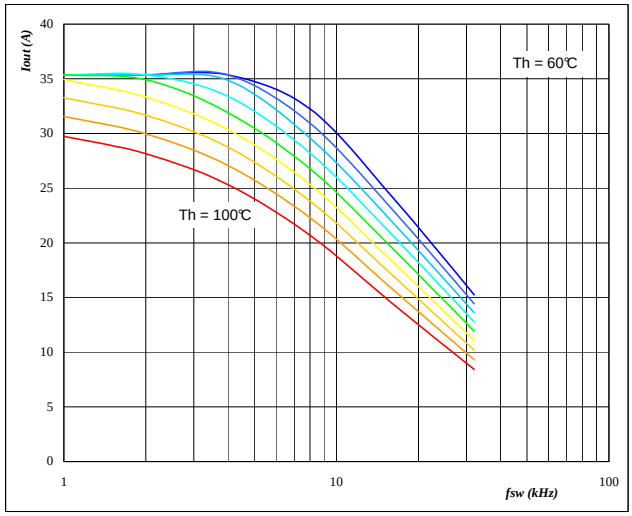

At

T_j =	150	℃
DC link =	600	V
Mi*cos φ =	0,8	
T_h from	60 ℃ to 100 ℃ in steps of 5 ℃	

Figure 7 Phase

Typical available 50Hz output current as a function of Mi*cos φ and switching frequency $I_{out} = f(f_{sw}, Mi*\cos\varphi)$

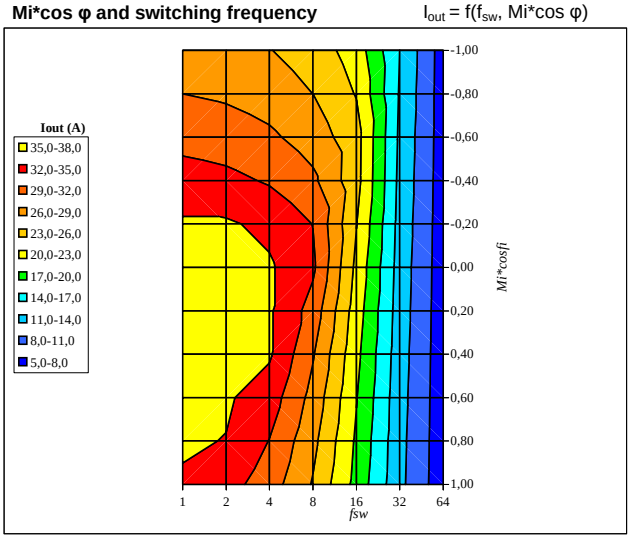

At

T_j =	150	℃
DC link =	600	V
T_h =	80	℃

Figure 8 Phase

Typical available 0Hz output current as a function of switching frequency $I_{outpeak} = f(f_{sw})$

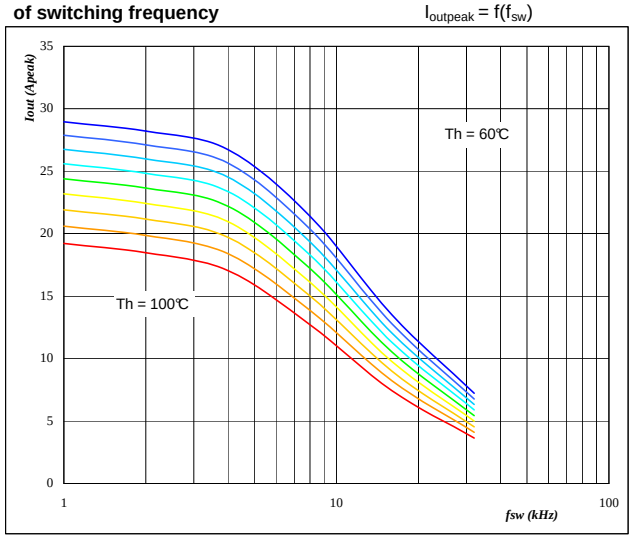

At

T_j =	150	℃
DC link =	600	V
T_h from	60 ℃ to 100 ℃ in steps of 5 ℃	
Mi =	0	

Figure 9 Inverter

Typical available peak output power as a function of heatsink temperature $P_{out}=f(T_h)$

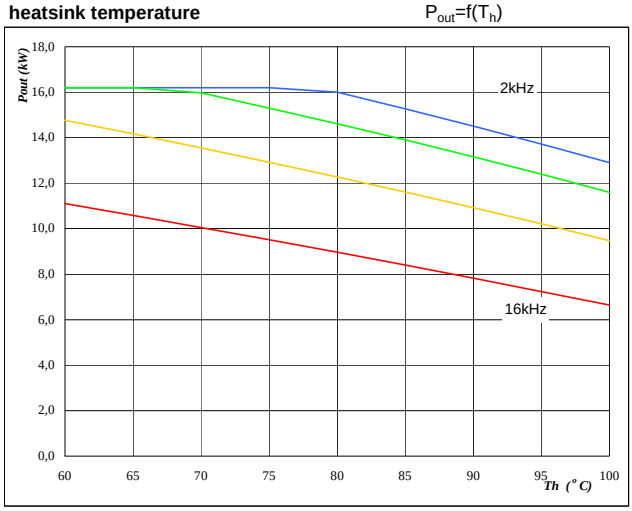

At

T_j =	150	℃
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 10 Inverter

Typical efficiency as a function of output power efficiency=f(P_{out})

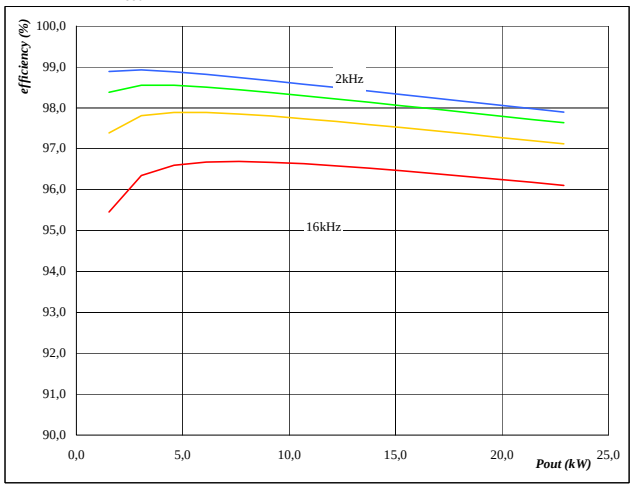

At

T_j =	150	℃
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 11 Inverter

Typical available overload factor as a function of motor power and switching frequency $P_{peak} / P_{nom}=f(P_{nom},f_{sw})$

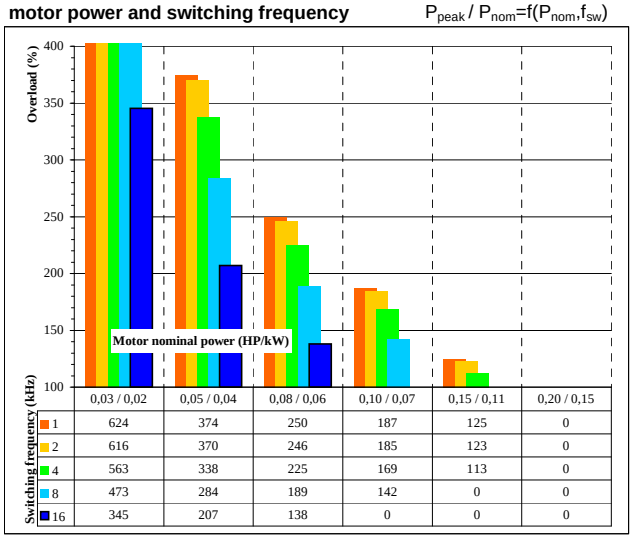

Switching frequency (kHz)	0,03 / 0,02	0,05 / 0,04	0,08 / 0,06	0,10 / 0,07	0,15 / 0,11	0,20 / 0,15
1	624	374	250	187	125	0
2	616	370	246	185	123	0
4	563	338	225	169	113	0
8	473	284	189	142	0	0
16	345	207	138	0	0	0

At

T_j =	150	℃
DC link =	600	V
Mi =	1	
cos φ=	0,8	
f_{sw} from	1 kHz to 16kHz in steps of factor 2	
T_h =	80	℃
Motor eff =	0,85	